## RISK OF CONFUSION BETWEEN TENSIONING PULLEYS 55428 AND 55719

**TECHNICAL INFO NO. 1061** 

VEHICLE MANUFACTURER/MODELS:		
Seat	Arosa, Cordoba, Ibiza II, Ibiza III, Ibiza IV, Inca	
Škoda	Felicia I, Felicia II, Octavia	
vw	Bora, Caddy II, Fox, Golf III, Lupo, Polo, Vento	

## **APPLIES TO ENGINES:**

1.0, 1.0i, 1.3, 1.4, 1.4i, 1.6, 1.6i, 1.9 TDI

APPLIES TO PART NO. :		
RUVILLE-No.:	OE-No.:	
55428	030 109 243K	
55719	030 109 243L	

APPLIES TO KITS:	
RUVILLE-No.:	
55428	5542870 timing belt kit 5542872 timing belt kit 55428701 waterpump kit 55428702 waterpump kit 55428721 waterpump kit
55719	5571970 timing belt kit 55719701 waterpump kit

## **IMPORTANT NOTE!**

Before installing the tensioning pulley, it must be ensured that the part number is correct. The similarity of the numbers means there is an increased risk of confusing these two components.

Note the specifications of the vehicle manufacturer



**Image 1:** Distinguishing between tensioning pulleys 55428 (left) and 55719 (right)

There is a risk that tensioning pulleys 55428 and 55719 could be confused with one another.

Not only are the item numbers very similar, there is very little to differentiate the devices from a visual perspective.

Only the pointers of the two tensioning pulleys and the alignment of the pointers (see image) is different.

However, from a technical perspective, the two devices are very different. Tensioning pulley 55428 has a higher tensioning force and a larger operating range than Before installing the tensioning tensioning pulley 55719.

Interchanging the tensioning pulleys could lead to oscillation, thereby causing the toothed belt to skip. It could even result in damage to the engine



## INFORMATION

The corresponding spare parts can be found in our online catalogue at www.ruville.de

Any reference to replacement part numbers for vehicle manufacturers is for comparison purposes only.

