

ASSEMBLY INSTRUCTIONS FOR TENSIONER 55262

TECHNICAL INFO NO. 1076

VEHICLE MANUFACTURER / MODELS:

Ford | Galaxy, Mondeo IV, S-Max

APPLIES TO ENGINES:

1.8 TDCi

APPLIES TO PART NO.:

RUVILLE-No.:	OE-No.:
55262	6G9Q-6A228-BC / 1425510 8G9Q-6A228-AA / 1567809

IMPORTANT NOTE!

You must use the new bolt enclosed with the tensioner!

Note the specifications of the vehicle manufacturer!

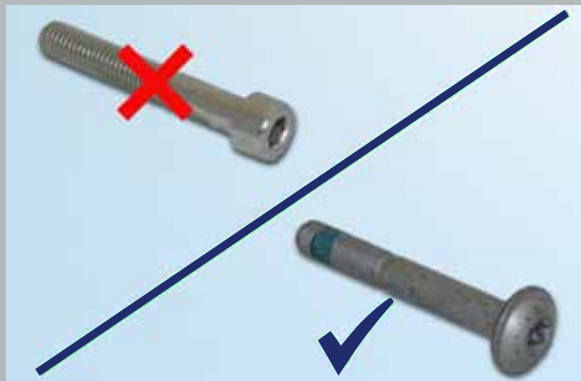


Image 3: Bolts

Furthermore, for engines with a crankshaft vibration damper, it must be checked whether this is mechanically OK and there is no damage to the rubber / metal joint.

If the crankshaft vibration damper is defective, it must be replaced.



Image 1: Version 1



Image 2: Version 2

In the vehicles listed, two different versions of the tensioner for the accessory drive are installed ex-works.

Version 1 (Image 1) can only be used in combination with a crankshaft vibration damper.

Version 2 (Image 2) can be installed both in vehicles with a crankshaft vibration damper and vehicles with a rigid crankshaft pulley. RUVILLE therefore only offers the version 2 tensioner.

When installing the tensioner 55262 offered by RUVILLE, it is imperative to ensure that the bolt removed from the old tensioner is replaced with the new bolt enclosed (Image 3).



INFORMATION

Corresponding spare parts can be found in our online catalogue at www.ruville.de. Where reference is made to the spare parts numbers of the vehicle manufacturers, this is only for the purposes of comparison.

