

REMEDY FOR NOISES TOWARDS THE ACCESSORY UNIT DRIVE

TECHNICAL INFO NO. 1108

VEHICLE MANUFACTURER / MODELS:

Astra H, Signum, Vectra C, Zafira B

APPLIES TO ENGINES:

Z18XER

APPLIES TO PART NO.:

RUVILLE-No.	OE-No.
55379	Opel: 1204484

IMPORTANT NOTE!

RUVILLE recommends that the vehicles affected be retrofitted with an over-running alternator pulley 55379: **Please note:** It is essential that the enclosed installation instructions are observed!

Note the specifications of the vehicle manufacturer!

Due to the strong vibrations of the V-ribbed belt, loud noises may be produced in the vehicles listed above with a rigid alternator belt pulley.

As a technical solution, RUVILLE offers an over-running alternator pulley for these vehicles. This reduces the dynamic loads in the accessory unit drive, thus preventing noise emissions.

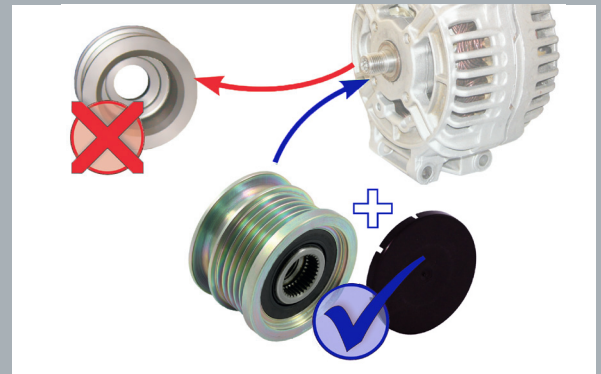


Image 1: Changing a rigid belt pulley on an over-running alternator pulley



Image 2: Over-running alternator pulley 55379



INFORMATION

Corresponding spare parts can be found in our online catalogue at www.ruville.de. Where reference is made to the spare parts numbers of the vehicle manufacturers, this is only for the purposes of comparison.