



Service Info



Differing deflection pulleys

on tensioning unit assembly 534 0243 10 in petrol and diesel engines

Manufacturer: Mercedes-Benz

Models: A 160 CDI (168.007)
to VIN J568589
A 170 CDI (168.008)
to VIN J568589

Engine codes: OM 668.940, OM 668.941

Part no.: 534 0243 10

OE-number: A 166 200 09 70



Image 1: Tensioning unit 534 0243 10

The tensioning unit assembly is fitted as standard with deflection pulleys that are suitable for petrol engines only.

To use the assembly on the diesel engines listed above, the left deflection pulley 532 0404 30 must be replaced with deflection pulley 532 0406 30 (image 2).

Deflection pulley 532 0406 30 for diesel engines has a smaller diameter than deflection pulley 532 0404 30 (image 2).

Other features, such as the colour of the sealing rings, do not affect the proper functioning of the unit and may vary.

The deflection pulley for diesel engines is not included in the assembly and must be ordered separately.

Ensure that the correct deflection pulley is fitted on the tensioning unit assembly before installing it in the vehicle!

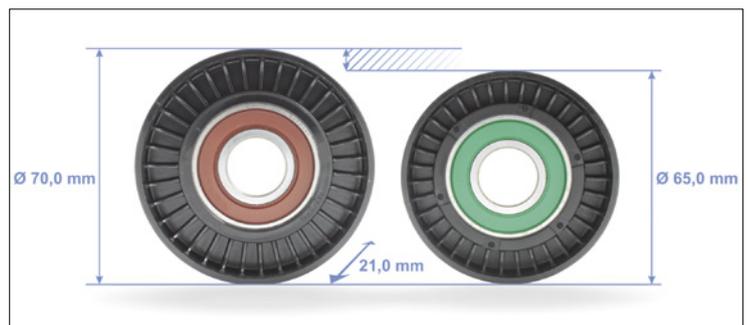


Image 2: Deflection pulley 532 0404 30 for vehicles with a petrol engine (left) and deflection pulley 532 0406 30 for vehicles with a diesel engine (right)

Note the specifications of the vehicle manufacturer!

Spare parts and technical information can be found under www.schaeffler-aftermarket.com or www.RepXpert.com.

Phone: +44 (0) 14 32 264 264*
Fax: +44 (0) 14 32 375 760
info@luk-as.co.uk
www.schaeffler-aftermarket.com

* Calls from within the UK 08457 001100

SCHAEFFLER
AUTOMOTIVE AFTERMARKET

