

RISK OF CONFUSION BETWEEN TENSIONER PULLEYS 55344 AND 55383

TECHNICAL INFO NO. 1021

APPLIES TO MANUFACTURER/MODELS:

Honda	Civic
Opel	Astra G, Astra H, Combo, Corsa B, Corsa C, Corsa D, Meriva, Zafira
Vauxhall	Astra Mk IV, Astra Mk V, Corsa Mk II, Combo, Meriva

APPLIES TO ENGINES:

1.7 DI, 1.7 DTi, 1.7 CDTi

APPLIES TO PART NO.:

RUVILLE-No.:	OE-No.:
55344	56 36 403
55344	97249945
55383	56 36 739
55383	97249944
55383	14530-PLZ-D00

IMPORTANT NOTE!

The pulleys are not interchangeable!
If the wrong tensioner pulley is fitted, the engine could be damaged.
Note the specifications of the vehicle manufacturer!

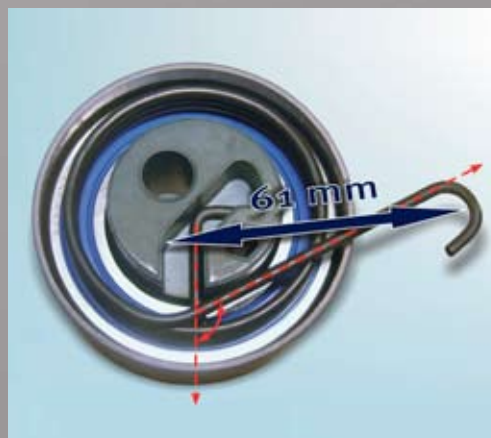


Image 1: 55344



Image 2: 55383

When replacing the tensioner pulley with part no. 55344 or 55383 precise vehicle allocation must be ensured.

There is very little visible difference between the two tensioner pulleys. The only difference is in the geometry of the tension spring (see Figures 1 and 2).



INFORMATION

The corresponding spare parts can be found in our online catalogue at [unter www.ruville.de](http://www.ruville.de)