

# ARTICLE INFORMATION ON OVERRUNNING ALTERNATOR PULLEY 55627

TECHNICAL INFO NO. 1005

**APPLIES TO MAKE/MODEL:**

Dacia, Renault

**APPLIES TO PART NO.:**

RUVILLE ref.	OE ref.	Generator ref.
55627	77 00 110 616 (replaced)	82 00 323 137
	77 01 477 689 (current)	

Should the alternator belt pulley be defective (OE ref. 77 00 110 616), it is to be replaced by an overrunning alternator pulley. The overrunning alternator pulley is available with RUVILLE No. 55627.

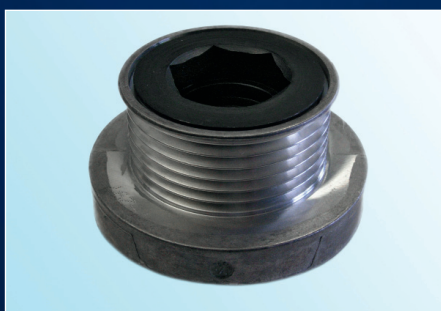


Fig. 1: Alternator Belt Pulley 77 00 110 616

**IMPORTANT NOTE:**

Adhere to the manufacturer's specifications at all times!  
A failure in the alternator belt pulley could interfere with the primary drive belt and cause expensive engine damage.



Fig. 2: Overrunning Alternator Pulley RUVILLE 55627

**Scope of delivery:**

1 x overrunning alternator pulley  
1 x sealing cap

**Assembly note:**

1. Slacken tensioner and remove poly V-Belt
2. Check all belt drive components for damage  
- replace damaged components
3. Remove the original belt pulley from the alternator (see Fig. 3)
4. Assemble the Overrunning Alternator 55627 with the relevant special tool.
5. Assemble the seal cap on the Overrunning Alternator Pulley  
- Ensuring it is seated correctly and is a tight fit!
6. Assemble the poly V-Belt

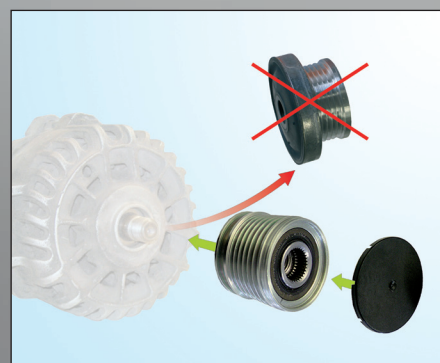


Fig. 3: Replacement procedure

**INFORMATION**

The corresponding spare parts can be found in our online catalogue at [www.ruville.de](http://www.ruville.de)